



90° Angle Spindle

RA-271E

OPERATION MANUAL

OM-K0424E 002

Thank you for purchasing 90° Angle Spindle " RA - 271E " : This Spindle is designed for grinding, small diameter drilling and milling, etc., ESD and ROTARYROLLER, Business Motor and Air Motor and Air Motor are required to use this Spindle. Please read this Operation Manual carefully before use. Always keep this Operation Manual in a place where a user can refer to for reference at any time.

1. CAUTIONS FOR HANDLING AND OPERATION

- Read these warnings and cautions carefully and only use in the manner intended.
- These warnings and cautions are intended to avoid potential hazards that could result in personal injury to the operator or damage to the device. These are classified as follows in accordance with the seriousness of the risk.

Class	Degree of Risk
⚠ WARNING	A safety hazard could result in bodily injury or damage to the device if the safety instructions are not properly followed.
⚠ CAUTION	A hazard that could result in light or moderate bodily injury or damage to the device if the safety instructions are not followed.

⚠ WARNING

- ① This Spindle is not a hand tool. It is designed to be used on CNC machines or special purpose machines.
- ② Do not touch the cutting tool while it is running. It is very dangerous.
- ③ Wear safety glasses, dust mask and use a protective cover around the Spindle whenever the Spindle is rotating.
- ④ This may cause electric shock.
- ⑤ Never operate or handle the Spindle and motor until you have thoroughly read the Operation Manual and safe operation has been confirmed.
- ⑥ To prevent injuries / damages, check the Spindle, motor and cutting tool for proper installation, before operating the Spindle and motor.
- ⑦ Before disconnecting the Spindle and motor, always turn the control power off and turn the compressed air supply to the CONTROLLER off. Then it is safe to remove the Spindle and motor.
- ⑧ When installing a Spindle to a fixed base, make sure the fixed base is grounded in order to avoid the risk of an electric shock.
- ⑨ When installing a tool, tighten the collet chuck correctly and check again the collet chuck before use. Do not over-tighten the collet chuck. This may cause damage to the Spindle.
- ⑩ Do not use bent, broken, chipped, out of round or sub-standard tools, as this may cause them to shatter or explode. Tools with fractures or a bent shank will cause injury to the operator.
- ⑪ When using a new tool, rotate it in a low speed and increase speed gradually for safety.
- ⑫ Do not use the recommended allowable tool speed. For your safety, use speeds below the maximum allowable speed.
- ⑬ Do not apply excessive force. This may cause tool slippage, tool damage, injury to the operator or loss of concentricity and precision.

⚠ CAUTION

- ① Do not exceed the maximum allowable motor speed 20,000min⁻¹ (rpm).
- ② Do not drop or hit this Spindle, as shock can damage to the internal components.
- ③ Be sure to clean the collet chuck, the inside of the spindle before replacing the tool. If ground particles or metal chips stick to the inside of spindle or the collet chuck, damage to the collet chuck or spindle can occur due to the loss of precision.
- ④ When cleaning a Spindle, stop the motor and remove debris with a soft brush or a cloth. Do not blow air into the Spindle with compressed air as foreign particles or cutting debris may not blow out.
- ⑤ Always clean the tool shank before installing the tool in the spindle.
- ⑥ When sizing the correct collet chuck size to the tool shank diameter, a tolerance of +0 ~ -0.01mm is strongly recommended. A tool shank within the +0 ~ -0.1mm range is mountable, however, this may cause poor concentricity and or insufficient tool shank gripping force.
- ⑦ Select suitable products or tools for all applications. Do not exceed the capabilities of the spindle or tools.
- ⑧ Do not stop the supply cooling air for motor during operation of the machine.
- ⑨ Removing the air pressure from the Motor / Spindle causes a loss of purging, allowing the Motor / Spindle to ingest coolant. This will cause damage to the Motor / Spindle.
- ⑩ Carefully direct coolant spray to the tool. Do not spray directly on the Spindle body. If large amount spray directly on the Spindle, it may cause excess load of the motor rotation with loss of durability to the Spindle.
- ⑪ Stop working immediately when abnormal rotation or unusual vibration are observed.
- ⑫ Always check the condition of rotation after starting.
- ⑬ Always check if the tool, collet chuck, spindle and motor are damaged before and after rating.
- ⑭ If the collet chuck show signs of wear or damage, replace it before a malfunction or additional damage occurs.
- ⑮ After installation, repair, initial operation, or long periods of non operation, please refer to section " 11. BREAK-IN PROCEDURE " detailed in Table. 2 When checking the Spindle, no vibration or unusual sound should be observed during rotation.
- ⑯ Do not disassemble, modify or attempt to repair this Spindle. Additional damage will occur to the internal components. Service must be performed by NSK NAKANISHI or an authorized service center.
- ⑰ When using this Spindle for mass production, please consider the purchase of an additional Spindle to be used as a back-up in case of emergency.

2. BASIC PACKAGE

When opening the package, check if it includes all items listed in " Table.1 Packing List Contents ". In the event of any shortage, please contact either NAKANISHI (see the " 4. CONTACT US " section) or your local dealer.

Table. 1 Packing List Contents

RA-271E Spindle • • 1pc.	Collet Chuck, $\phi 3.0\text{mm}$ (CHS-3.0) or $\phi 3.175\text{mm}$ (CHS-3.175) • • 1pc. (For U.S. market $\phi 3.175\text{mm}$ (CHS-3.175))	Wrench (7 x 5.1) (8 x 5.1) (22 x 27) • • Each 1pc.
Inspection Card • • 1pc.	Operation Manual • • 1set	

* The collet chuck is attached to the Spindle.

3. WARRANTY

We provide a limited warranty for our products. We will repair or replace the products if the cause of failure is due to the following manufacturers defects. Please contact us or your local distributor for details.

- ① Defect in manufacturing.
- ② Any shortage of components in the package.
- ③ Where damaged components are found when initially opening the package.
(This shall not apply if the damage was caused by the negligence of a customer.)

4. CONTACT US

If you have any questions and convenience when purchasing our products, we welcome your questions. If you have any questions about operation, maintenance and repair of the product, please contact us.

📞 Contact Us

- For U.S. Market
Company Name
: **NSK America Corp**
Industrial Div.
: 8:30am to 17:00pm (CST)
(closed Saturday, Sunday and Public Holidays)
: 800-585-4875
Telephone No.
: 847-545-7854
Fax No.
: 847-545-7924
Web Address
: www.nskamericacorp.com
- For Other Markets
Company Name
: **NAKANISHI INC.**
Industrial Div.
: 8:00am to 17:00pm
(closed Saturday, Sunday and Public Holidays)
: +81 (0) 289-64-9520
Telephone No.
: webmaster-4@nsk-nakanishi.co.jp
e-mail Address

5. FEATURES

- ① These Spindles are capable of working on corners difficult to work or unfit for working with straight type Spindle.
- ② The Spindle housing is made from precision ground, hardened, stainless steel (SUS) with an outside diameter of $\phi 30\text{mm}$.
- ③ Various sizes of collet chucks are available CHS 0.8mm ~ 3.0mm. Standard collet chuck is CHS 3.0mm or CHS 3.175mm. (For U.S. market CHS 3.175mm.)

6. SPECIFICATIONS AND DIMENSIONS

6-1 Specifications

Model	RA-271E
Maximum rotating speed at the tool	For Air Motor 12,700min ⁻¹ (rpm) For Business Motor 13,300min ⁻¹ (rpm)
Maximum Motor Rotation Speed	For Air Motor 19,000min ⁻¹ (rpm) For Business Motor 20,000min ⁻¹ (rpm)
Applicable Motor	For Air Motor AM-3020R / L, AM-3020RA / LA For Business Motor EM-3060, EM-3060J, EM-3060U-2M, EM-3030J, EM-3030U-2M
Reduction Ratio	1 / 1.5
Standard Collet Chuck (CHS-3.0)	$\phi 3.0\text{mm}$
Weight	240g

⚠ CAUTION

Use less than the maximum allowable motor speed 20,000min⁻¹.
DO NOT exceed the maximum allowable motor speed 20,000min⁻¹ for the Spindle.

< Option >

Collet Chuck (CHS-□□□) $\phi 0.8\text{mm} \sim \phi 3.0\text{mm}$ in 0.1mm increments and $\phi 2.35\text{mm}$, $\phi 3.175\text{mm}$

6-2 Outside View

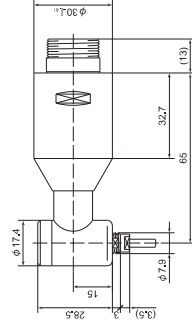


Fig. 1

7. CONNECTION OF THE SPINDLE TO THE MOTOR

⚠ CAUTION

Make sure your hands and all interlocking parts of the Spindle and motor are clean before connecting the motor to the Spindle. This is critical in preventing contaminants from entering the motor or Spindle.

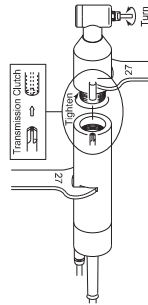


Fig. 2

8. CHANGING THE TOOL

⚠ CAUTION

Do not tighten the collet chuck without inserting a tool or dummy bar as this will result in damage to the collet chuck.

RECOMMENDATION

Please set the cutting tools to minimize the overhang amount. 13mm is the maximum amount of overhang to maintain high accuracy and safety.

 


Fig. 3

9. REPLACING THE COLLET CHUCK

- ① Remove the tool according to the section " 8. CHANGING THE TOOL " procedure above (Fig. 3).
- ② Place the provided 7mm wrench on the spindle shaft, and turn the top of the collet chuck counterclockwise to remove the collet chuck (Fig. 4).
- ③ Install the new collet chuck into the Spindle by turning it clockwise.

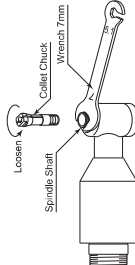


Fig. 4

10. INSTALLATION OF THE SPINDLE

⚠ WARNING

When installing a Spindle to a fixed base, make sure the fixed base is grounded in order to avoid the risk of an electric shock.

⚠ CAUTION

- When installing a Spindle, do not hit, drop or cause shock to the Spindle. This may cause damage to internal components and result in malfunctions.
 - When mounting the Spindle, be sure to secure within Clamping Area etched on the Spindle O.D. If the Spindle is installed incorrectly, damage to the internal components is possible.
 - Cautions when tightening the securing bolts on to a Split Type Holder
 - Do not over-tighten the Bolt. This will cause damage to Spindle's precision.
 - Tightening must be carried out and checked by hand within the fixture.
 - Extreme tightening is unnecessary or over-tightened.
- Apply working force and check that the Spindle is tight before using.

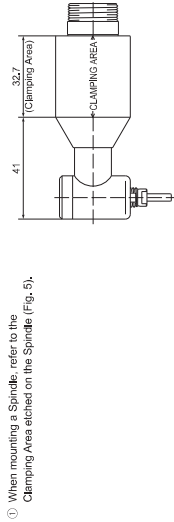


Fig. 5

- When installing the Spindle, it is recommended to use a GR-30 Grip Ring (sold separately (Fig. 9)). The GR-30 Grip Ring cannot be used in the case of the Spindle's rotation and space, install as shown in ③ below.

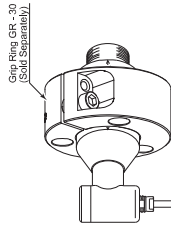


Fig. 6

- When installing a Spindle to the holder, recommended installation method is shown Fig. 7. Refer to "③ How to fabricate the Split Type Holder". If this is not possible, install as shown in Fig. 8.

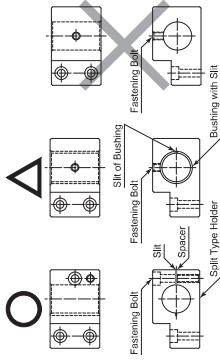


Fig. 7

Fig. 8

Fig. 9

⚠ CAUTION

Do not allow set screws to come directly in contact with the Spindle body as shown in Fig. 9, as this will result in damage to the Spindle housing and internal components. When installing, never clamp directly over the bearings, as this will result in bearing damage (Refer to Fig. 10).

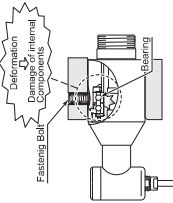


Fig. 10

- How to fabricate the Split Type Holder
 - Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
 - Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
 - Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.

- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.
- Remove the fastening bolt and the fastening nut from the rear of the Split Type Holder.

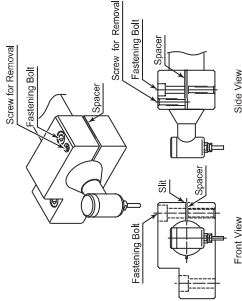


Fig. 11

⚠ CAUTION

- How to confirm the correct tightening or damping of the Spindles in the holder : In case of use a brushless motor.
 - Measure the current value of the CONTROLLER power cord by the clamp meter.
 - Fasten the holder so that the increase in the no-load current value (during rotation at the maximum rotation speed) with the Spindle fastened is 10mA (for type 200V / 230V) or less, compared to the no-load current value (during rotation at the maximum rotation speed) of the Spindle without the holder.
 - When the increase in the no-load current value is 10mA or more, it may damage Spindle's precision and shorten the life of the Spindle.
 - The final responsibility for ensuring holder's safety for use in a given application is left to the designer of the equipment in which NAKANISHI's Spindle is installed.
- NAKANISHI offers Spindles with a wide variety of capabilities and specifications. Please carefully check the Spindle's specifications against the requirements of your equipment and verify suitability and safety of the Holder prior to initial use.

11. BREAK-IN PROCEDURE

During transportation, storage or installation, the grease inside the bearings will settle. If the Spindle is suddenly run at high-speed, the grease will be ejected from the bearings, causing excessive heat that will cause bearing damage. After installation, repair, initial operation, or long periods of non operation, please follow the break-in procedure detailed in Table, 2.

Table, 2

Steps	1	2	3	4
Air Pressure (MPa)	0.1	0.2	0.3	0.4
Air Pressure (psi)	14.5	29	43.5	58
Rotation Speed (min ⁻¹ /rpm)	5,000	10,000	15,000	20,000
Rotation Time (min)	15	10	10	15
Items to Check	The Spindle housing temperature during the break-in process should not exceed 20 degrees C (36 degrees F) above ambient temperature. Should the Spindle exceed this limit, rest the Spindle for at least 20 minutes and re-start the break-in procedure from the beginning. If the housing temperature exceeds 20 degrees C (36 degrees F) above ambient temperature, check the Spindle and motor for proper installation.			

12. CAUTIONS WHEN USING GRINDSTONES AND TOOLS

⚠ CAUTION

The maximum surface speed or rpm is always specified for a grindstones. Do not exceed the maximum speed with reference to the calculating chart below. Always follow the grindstone manufacturer's recommendations.

$$\text{Surface Speed (m/s)} = \frac{3.14 \times \text{Diameter (mm)} \times \text{Rotation Speed (min}^{-1}\text{/rpm)}}{1,000 \times 60}$$

- The proper surface speed for general grindstones is 10-30m/s.
- Do not exceed 13mm of overhang for mounted grindstones as shown in Fig. 12. If the overhang must exceed 13mm, reduce the motor speed in accordance with Table, 3.
- When grinding, the maximum depth of cut should not exceed 0.01mm radially or axially. Reciprocate the tool several times after each pass to eliminate tool pressure.
- Always operate cutting tools within the allowable recommended speed of the cutting tools. Use of a cutting tool outside of the allowable speed of the cutting tools could cause damage to the spindle and injury to the operator.
- Keep the cutting tool shank and collet chuck clean. If contaminants are left in the collet chuck or chuck nut, excessive run-out will cause damage to the cutting tool and Spindle.
- Do not strike or disassemble the Spindle.
- Please set the cutting tools to minimize the overhang amount. 3mm is the maximum amount of overhang to maintain high accuracy and safety.

Table, 3 Overhang and Speed

Overhang (mm)	Max. Speed (min ⁻¹ /rpm)
20	N x 0.5
25	N x 0.3
50	N x 0.1

* N = Max. Operating Speed with 13mm overhang.

 


Fig. 12

13. TROUBLESHOOTING

If a problem or concern occurs, please check the following prior to consulting your dealer.

Trouble	Cause	Inspection / Corrective Action
Spindle does not rotate smoothly.	The Spindle ball bearings have been damaged.	Replace the ball bearings. (Return to NAKANISHI dealer service.)
	The motor has been damaged.	Replace the motor. (Return to NAKANISHI dealer service.)
Overheating during rotation.	Cutting debris has contaminated the ball bearings, and the ball bearings are damaged.	Replace the ball bearings. (Return to NAKANISHI dealer service.)
Abnormal vibration or noise during rotation.	The tool shank is bent.	Replace the tool.
	Cutting debris has contaminated the ball bearing.	Replace the ball bearings. (Return to NAKANISHI dealer service.)
	The Spindle ball bearings have been damaged.	Replace the ball bearings. (Return to NAKANISHI dealer service.)
Tool slippage.	Collet chuck is not correctly installed.	Check and clean the collet chuck. Reinstall the collet chuck.
	The collet chuck is worn.	Replace the collet chuck.
High run-out.	The tool is bent.	Change the tool.
	Collet chuck is not correctly installed.	Secure the collet chuck correctly.
	The collet chuck is worn.	Replace the collet chuck.
	Inside of the Spindle is worn.	Replace the Spindle shaft. (Return to NAKANISHI dealer service.)
	Contaminants inside the collet chuck or the Spindle.	Clean the collet chuck and the inside of the Spindle.
	The Spindle ball bearings have been damaged.	Replace the ball bearings. (Return to NAKANISHI dealer service.)

In case of using a Brushless Motor, refer to Brushless Motor and E3000 CONTROLLER Operation Manuals.

14. DISPOSAL OF THE SPINDLE

When disposal of a Spindle is necessary, follow the instructions from your local government agency for proper disposal of industrial components.